
Thompson Rd. 5000S

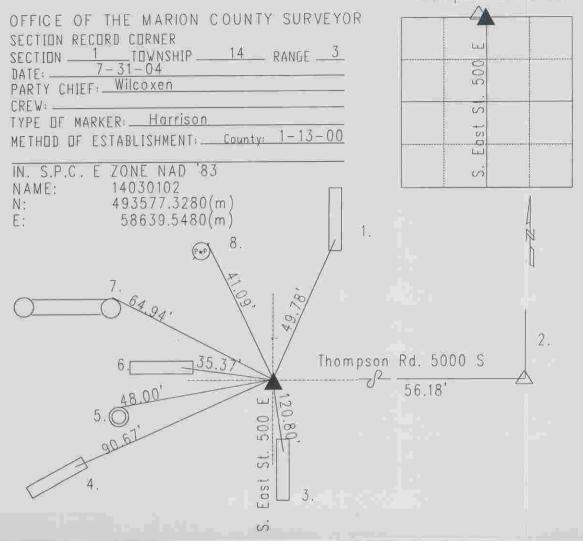

Corner originally set as a post in 1820 by William B. Laughlin with the following witnesses: 12" Beech bearing north 72 degrees, thence west 34 links; and a 14"hickory bearing south 61 degrees, thence east 19 links. (M.C.Atlas p. 5) A survey by Percy Hasbrook on April 16,1849 indicates a large rock and one witness. (Perry Legal Book p. 5) Corner referenced by MCS in 1951 and called a brass pin. Corner referenced by Scherchel in 1970 and called a p.k. Nail. Corner referenced by Mcommack on 5/13/75 and called a p.k.nail. Corner referenced by Wilcoxen on 9/25/75 and called a p.k. Nail. Corner referenced by Wilcoxen on 3/19/91 and called a brass plug. Corner referenced by Wilcoxen on 10/1/95 and called a p.k. Nail over a brass plug. Corner referenced by Wilcoxen on 1/13/2000 and called a p.k. Nail over brass plug. Corner excavated by Wilcoxen on 7/12/04 and called a cut x in concrete. A #205 cast iron Harrison Monument was set in position as the corner per ties and GPS control.

14030102		
REF.	DISTANCE	DESCRIPTION
j.	49,78	Cut 'x' in S-end of median
2.	56.18'	Due E to S Q 36-15-3 (Harrison)
3.	120,80	Cut 'x' N-end of median
4.	90.67	Cut 'x' in median
5.	48.00'	Cut 'x' N-edge of sewer manhole rim
6.	35.37'	Cut 'x' in E concrete walk ramp
7.	64.94	Cut 'x' N East post of Heritage House sign
8.	41.09*	Road nail NE PwP#24-696 A 2"up